


dryspin lead screw nut out of iglide J350 |
geometry: flange | metric thread | LH
J350FLM-0913M3

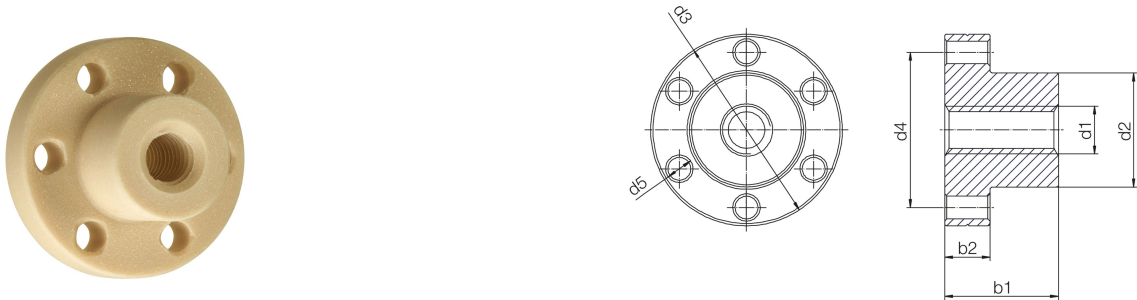

dryspin lead screw nut out of iglide J350 |
geometry: flange | metric thread | LH

- Material: iglide® J350
- Thread direction: Right-hand thread
- Thread type: metric thread
- Design: Standard
- Cylindrical lead screw nut with flange

Product description

Introducing the drylin® lead screw nut, metric thread, J350FLM from igus. Crafted from high-performance iglidur® J350 material, this lead screw nut is designed for medium to high temperatures, enduring up to +150°C. It offers exceptional dimensional stability, is 100% lubrication-free, and resistant to chemicals. Ideal for the railway industry, it ensures quiet and vibration-free operation while providing robust performance in demanding environments. Experience durability and reliability with this innovative solution.

Requirements

Mould-resistant according to DIN EN ISO 846 Procedure A	Yes
---	-----

Thermal properties

Efficiency [η]	17-24
----------------	-------

General properties

Thread direction	Right-hand thread
Thread type	Metric thread; standard for highest compatibility
With spanner flat	No
Weight	9.54 g




Dimensions

Thread size	M3
Ø d1	3 mm
Ø d2	9 mm
Ø d3	18 mm
Ø d4	15.2 mm
Ø d5	3.2 mm
b1	13 mm
b2	3 mm




Additional information and diagrams

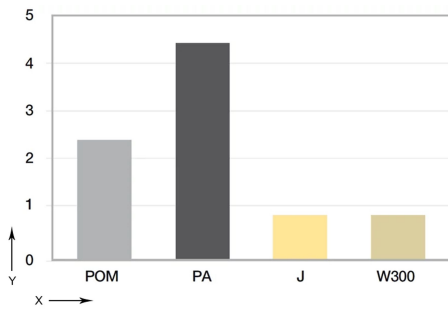

Wear test on a rolled trapezoidal lead screw

x = different materials

y = wear [mg/km]

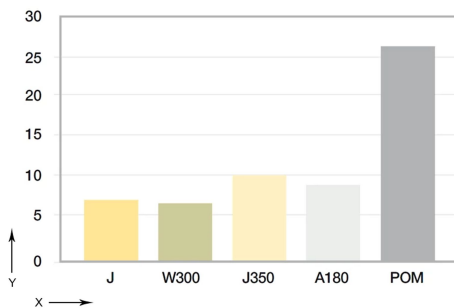


Wear test on C15 lead screw drive

Stroke 140 mm, 50 N, lead screw C15 rolled, 450 rpm

x = different materials

y = wear [mg/km]

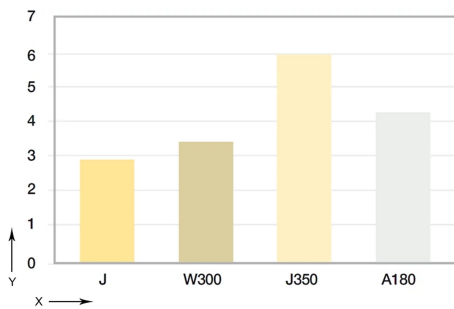


Wear test on a VA lead screw

Stroke 140 mm, 50 N, lead screw VA rolled, 450 rpm

x = different materials

y = wear [mg/km]



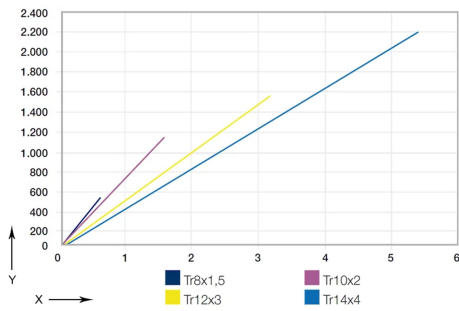


Required drive torque lead screw modules Ø8 to Ø14

Assuming $\mu = 0.25$, without considering the lead screw supports

x = torque [Nm]

y = load [N]

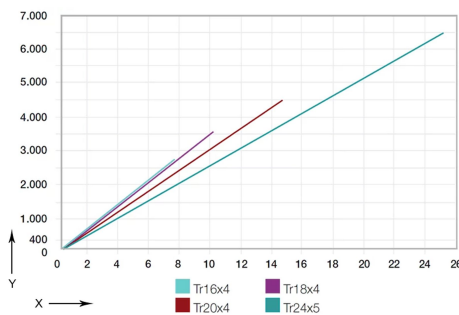


Required drive torque lead screw modules Ø16 to Ø24

Assuming $\mu = 0.25$, without considering the lead screw supports

x = torque [Nm]

y = load [N]

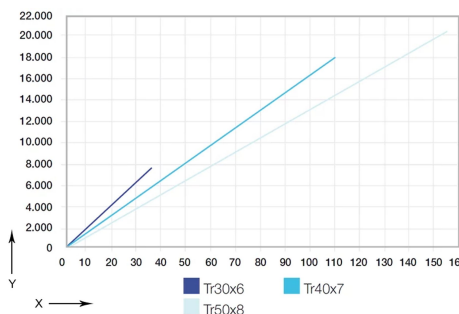


Required drive torque lead screw modules Ø30 to Ø50

Assuming $\mu = 0.25$, without considering the lead screw supports

x = torque [Nm]


y = load [N]



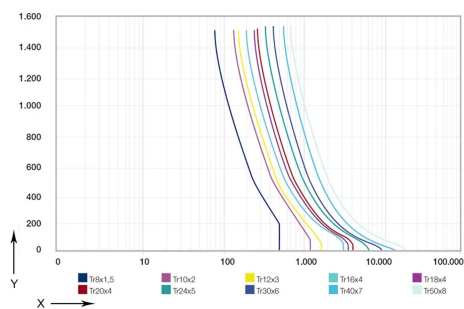

Maximum dynamic load for lead screw units with 10% ESD

x = load [N]
y = speed [rpm]

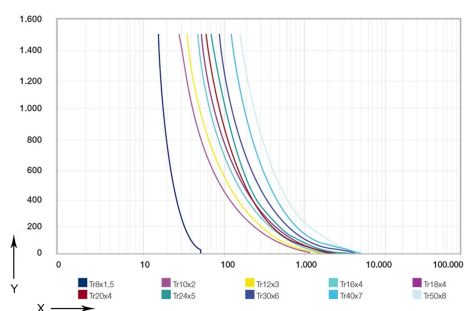

Maximum dynamic load for lead screw units with 100% ESD

x = load [N]
y = speed [rpm]