
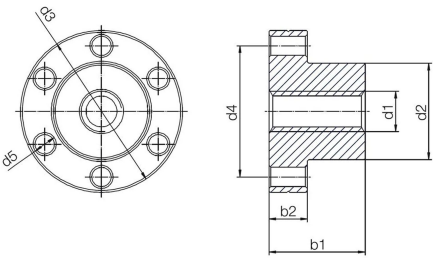


drylin® trapezoidal lead screw nut with flange,
J350FLM

J350FLM-2020TR8X1.5

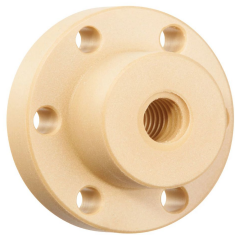

drylin® trapezoidal lead screw nut with flange,
J350FLM

- Material: iglide® J350
- Thread direction: Left-hand thread
- Thread type: Trapezoidal threads
- Design: Standard
- Cylindrical lead screw nut with flange

Product description

Introducing the drylin trapezoidal lead screw nut with flange, J350FLM by igus. Crafted from high-performance iglidur J350 material, this nut is designed for durability in medium to high temperatures, up to +150°C. It offers excellent stability, is lubrication-free, and maintenance-free, making it ideal for various applications, including the railway industry. Enjoy quiet, vibration-free operation and resistance to wear and chemicals with this robust lead screw nut.

Requirements

Mould-resistant according to DIN EN ISO 846 Procedure A	No
---	----

Thermal properties

Efficiency [η]	19-33
----------------	-------

General properties

Thread direction	Left-hand thread
Thread type	Trapezoidal threads; absorption of larger axial forces
With spanner flat	No
Weight	45.9 g




Dimensions

Thread size	TR08X1.5
Ø d1	8 mm
Ø d2	20 mm
Ø d3	36 mm
Ø d4	28 mm
Ø d5	4 mm
b1	20 mm
b2	8 mm




Additional information and diagrams

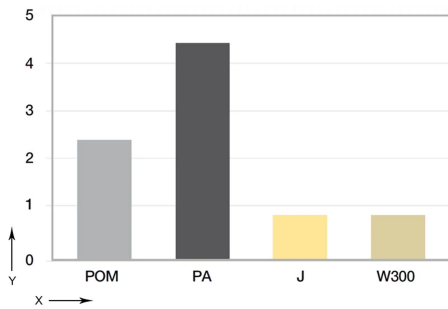

Wear test on a rolled trapezoidal lead screw

x = Different materials

y = Wear [mg/km]

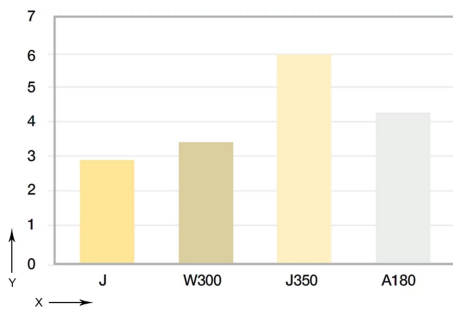


Wear test on a VA lead screw

Stroke 140 mm, 50 N, lead screw VA rolled, 450 rpm

x = Different materials

y = Wear [mg/km]

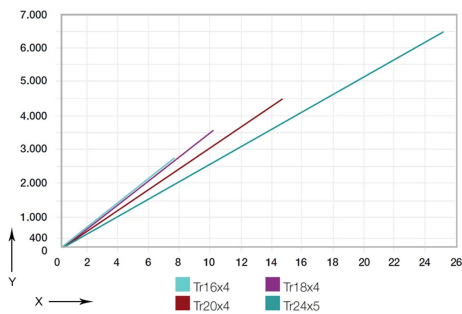


Required drive torque lead screw modules Ø16 to Ø24

Assuming $\mu = 0.25$, without considering the lead screw supports

x = Torque [Nm]

y = Load [N]



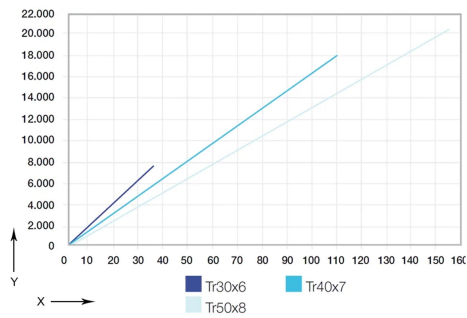


Required drive torque lead screw modules Ø30 to Ø50

Assuming $\mu = 0.25$, without considering the lead screw supports

x = Torque [Nm]


y = Load [N]

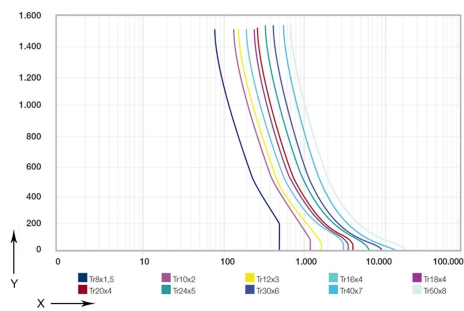

Maximum dynamic load for lead screw units with 10% ESD

x = load [N]

y = speed [rpm]

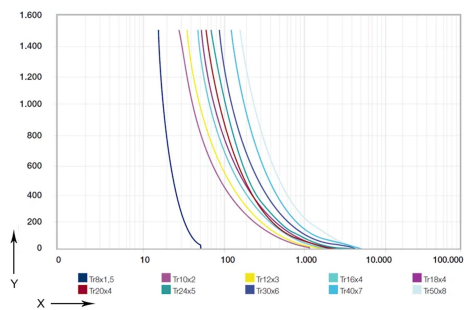

Maximum dynamic load for lead screw units with 100% ESD

x = load [N]

y = speed [rpm]